



**Firmware Version:** 4.1.0.8  
**Published:** Apr 11, 2012

---

**Content:**

Revision History and System Requirement: .....2

New Features: .....2

Problems Fixed: .....3

Known Issues: .....5

Related Documentation: .....8

## Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
Runtime: V4.1.0.8	11-Apr-12	DWL-3600AP	A1G
		DWL-6600AP	A1G
		DWL-8600AP	A1G
Runtime: V4.1.0.4	20-Mar-12	DWL-6600AP	A1G
Runtime: V4.1.0.2	15-Jan-12	DWL-8600AP	A1G
		DWL-6600AP	A1G
		DWL-3600AP	A1G

## New Features:

Firmware Version	New Features
V4.1.0.8	CE DFS channels has been restored. Though it must be noted that 6600AP has yet to obtain CE DFS certification as of this writing.
V.4.1.0.4	Disable CE DFS channels for 6600AP
V4.1.0.2	<p>First V4.0 release (internally referred to as Helio2). Baseline feature reference Ver4.0 functional spec</p> <p>New Features and changes over V3.0.0.16 include</p> <ul style="list-style-type: none"> <li>● Aeroscout integration – DWL-3600AP, DWL-6600AP, and DWL-8600AP is now able to work with Aeroscout tags and management software to provide location tracking service.</li> <li>● Radio scheduler – The ability for a user to configure windows of time for VAPs or radios to be enabled or disabled</li> <li>● Rogue AP notification – Syslog messages and traps when new rogue APs are discovered by RF Scan, and email alert will be sent out.</li> <li>● MIB files have a .mib file extension rather than a .my extension.</li> <li>● Managed-AP mode is enabled by default</li> <li>● Dual boot feature no longer supported</li> </ul>

## Problems Fixed:

Firmware Version	Problems Fixed
	<ol style="list-style-type: none"> <li>1. [AP][WDS+SMB] If WDS mode with SMB traffic about 1~2 days, the AP will cause Ethernet port hang [<a href="#">LVL700168205</a>]</li> <li>2. 3600 APs lost management with Undirected ARP Req. floods to the managed switch(4026).[<a href="#">LVL700171117 (config error was the cause)</a>]</li> <li>3. AP is not sending UDP 57776 packets when Wireless switch does not have discovery enabled [<a href="#">LVL700171972</a>]</li> <li>4. Unable to reliably change WDS encryption without losing DHCP connectivity for extended periods [<a href="#">LVL700175132</a>]</li> <li>5. [DWL-8600AP] Unstable signal strength in a secondary BSSID in Multi-SSID [<a href="#">DI20110218000011-Japan</a>][<a href="#">LVL700155847</a>]</li> <li>6. 0xd3d28f8 (wlanWdmTask): Memory Corruption by task id - d3d28f8 and reset [<a href="#">LVL700163706</a>]</li> <li>7. failed to load factory defaults seen after firmware upgrade [<a href="#">LVL700167818</a>]</li> <li>8. WLAN utilization doesn't change with change in traffic through AP. [<a href="#">LVL700170915 (Verified. Function is as designed)</a>]</li> <li>9. Locking one radio channel in clustering channel management page causes both radios to be locked. [<a href="#">LVL700172121 (test error was the cause)</a>]</li> <li>10. Clustered 3600s do not share configs. [<a href="#">LVL700172122</a>]</li> <li>11. Mac Authentication black list/white list not operating properly. [<a href="#">LVL700174532 (test error was the cause)</a>]</li> <li>12. Wireless kept old IP address after changing switch static IP to a new address in same subnet. [<a href="#">LVL700174733</a>]</li> <li>13. 6600AP DFS channels do not trigger on RADAR [<a href="#">LVL700169740</a>]</li> <li>14. 6600AP crashes while attempting tunneling [<a href="#">LVL700174549</a>]</li> <li>15. WDS webpage on 6600AP takes excessively long to load. [<a href="#">LVL700171955</a>]</li> <li>16. 3600AP and 6600AP Endurance Test – LAN to Wireless (UDP/ Multicast/ Broadcast), and Wireless to LAN (Multicast/ Broadcast). DUT failed to transmit the traffic to wireless clients after 212 seconds running. [<a href="#">DBG12020268</a>]</li> <li>17. The message “invalid image” is displayed in the GUI if the AP was powered off during the boot-up process.</li> <li>18. not seeing the managed peers on the dlink gui [<a href="#">LVL700170818 (Function is as designed. Require peer configuration push)</a>]</li> </ol>
V.4.1.0.4	<ol style="list-style-type: none"> <li>1. Aeroscout gives error configuring 3600AP. Appears 3600AP fails to respond correctly. [<a href="#">LVL700174456</a>]</li> </ol>

2. [Qos DiffServ Policy] The Committed Rate can't work correctly.  
[[LVL700168202](#)]
3. AP Crashes if roaming delay test is run for multiple clients using Veriwave  
[[LVL700170934](#)]
4. 3600 Scheduling not occurring [[LVL700171190](#)]
5. [AP][Client QoS ACL+IPv6] Input ipv6 address ::33, WEB UI will appear  
debug message. [[LVL700168211](#)]
6. Client database not purged when new cluster controller is elected  
[[LVL700170909](#)]
7. Scheduler page missing some information. [[LVL700171193](#)]
8. Not able to set the static channel on the ap from the wireless cluster controller  
[[LVL700171319](#)]
9. Traps being sent to the syslog server do not have the time that was gotten  
from SNTP. [[LVL700171881](#)]
10. 3600 AP crashed while running Automation suit. [[LVL700174681](#)]
11. 6600AP crashes while sending BCast & MCast flood into managed switch  
[[LVL700171115](#)]

V.4.1.0.2

Initial release

## Known Issues:

Firmware Version	Issues
	<ol style="list-style-type: none"> <li>1. Clients lose association during Chariot run after ~2 hours [<a href="#">LVL700168082</a> (difficult to reproduce)]</li> <li>2. 3600 cell recovery - power not adjusting when 1 neighbor goes down [<a href="#">LVL700171102</a>]</li> <li>3. emWeb hang while pushing peer configuration (can only be repeated with large configuration files in overnight runs). [<a href="#">LVL700174469</a>]</li> <li>4. [QoS ACL+IPv6] Please remove protocol type: IP and ICMP when IPv6 is selected. [<a href="#">LVL700168204</a>]</li> <li>5. [AP][Client Qos ACL+IPv6+IGMP] Only permit IPv6:IGMP, but fail. [<a href="#">LVL700168209</a>]</li> <li>6. Cluster controller pushes power change to RADIUS-power-set AP [<a href="#">LVL700169684</a>]</li> <li>7. When AP's are assigned addresses with x.x.x.255 they won't communicate to other devices. [<a href="#">LVL700174543</a> (this is a problem with VxWorks stack. Addresses that ends with 255 is not recommended)]</li> <li>8. Call recover for a 6600AP – power doesn't go back down after the one neighbor comes back. [<a href="#">LVL700171104</a>]</li> <li>9. 6600AP Web Server-Session Timeout-Test by IE8. The login web page will pop up again and again even user has input correct credentials after the web session timeout. [<a href="#">DBG12020202</a>]</li> </ol>
V4.1.0.4	<ol style="list-style-type: none"> <li>1. Clients lose association during Chariot run after ~2 hours [<a href="#">LVL700168082</a>]</li> <li>2. [AP][WDS+SMB] If WDS mode with SMB traffic about 1~2 days, the AP will cause Ethernet port hang [<a href="#">LVL700168205</a>]</li> <li>3. 3600 cell recovery - power not adjusting when 1 neighbor goes down [<a href="#">LVL700171102</a>]</li> <li>4. 3600 APs lost management with Undirected ARP Req. floods to the managed switch(4026). [<a href="#">LVL700171117</a>]</li> <li>5. AP is not sending UDP 57776 packets when Wireless switch does not have discovery enabled [<a href="#">LVL700171972</a>]</li> <li>6. emWeb hang while pushing peer configuration (can only be repeated with large configuration files in overnight runs). [<a href="#">LVL700174469</a>]</li> <li>7. Unable to reliably change WDS encryption without losing DHCP connectivity for extended periods [<a href="#">LVL700175132</a>]</li> </ol>

8. [DWL-8600AP] Unstable signal strength in a secondary BSSID in Multi-SSID [DI20110218000011-Japan][LVL700155847 (rejected)]
9. 0xd3d28f8 (wlanWdmTask): Memory Corruption by task id - d3d28f8 and reset [LVL700163706]
10. failed to load factory defaults seen after firmware upgrade [LVL700167818]
11. [QoS ACL+IPv6] Please remove protocol type: IP and ICMP when IPv6 is selected. [LVL700168204]
12. [AP][Client Qos ACL+IPv6+IGMP] Only permit IPv6:IGMP, but fail. [LVL700168209]
13. Cluster controller pushes power change to RADIUS-power-set AP [LVL700169684]
14. not seeing the managed peers on the dlink gui [LVL700170818]
15. WLAN utilization doesn't change with change in traffic through AP. [LVL700170915]
16. Locking one radio channel in clustering channel management page causes both radios to be locked. [LVL700172121]
17. Clustered 3600s do not share configs. [LVL700172122]
18. Mac Authentication black list/white list not operating properly. [LVL700174532]
19. When AP's are assigned addresses with x.x.x.255 they won't communicate to other devices. [LVL700174543]
20. Wireless kept old IP address after changing switch static IP to a new address in same subnet. [LVL700174733]
21. 6600AP DFS channels do not trigger on RADAR [LVL700169740]
22. 6600AP crashes while attempting tunneling [LVL700174549]
23. Call recover for a 6600AP – power doesn't go back down after the one neighbor comes back. [LVL700171104]
24. WDS webpage on 6600AP takes excessively long to load. [LVL700171955]
25. 3600AP and 6600AP Endurance Test – LAN to Wireless (UDP/ Multicast/ Broadcast), and Wireless to LAN (Multicast/ Broadcast). DUT failed to transmit the traffic to wireless clients after 212 seconds running. [DBG12020268]
26. 6600AP Web Server-Session Timeout-Test by IE8. The login web page will pop up again and again even user has input correct credentials after the web session timeout. [DBG12020202]

V4.1.0.2

1. Aeroscout gives error configuring 3600AP. Appears 3600AP fails to respond correctly. [LVL700174456]

2. Clients lose association during Chariot run after ~2 hours [[LVL700168082](#)]
3. [Qos DiffServ Policy] The Committed Rate can't work correctly. [[LVL700168202](#)]
4. [AP][WDS+SMB] If WDS mode with SMB traffic about 1~2 days, the AP will cause Ethernet port hang [[LVL700168205](#)]
5. AP Crashes if roaming delay test is run for multiple clients using Veriwave [[LVL700170934](#)]
6. 3600 cell recovery - power not adjusting when 1 neighbor goes down [[LVL700171102](#)]
7. 3600 APs lost management with Undirected ARP Req. floods to the managed switch(4026). [[LVL700171117](#)]
8. 3600 Scheduling not occurring [[LVL700171190](#)]
9. AP is not sending UDP 57776 packets when Wireless switch does not have discovery enabled [[LVL700171972](#)]
10. emWeb hang while pushing peer configuration [[LVL700174469](#)]
11. Unable to reliably change WDS encryption without losing DHCP connectivity for extended periods [[LVL700175132](#)]
12. [DWL-8600AP] Unstable signal strength in a secondary BSSID in Multi-SSID [[DI20110218000011-Japan](#)][[LVL700155847](#)]
13. 0xd3d28f8 (wlanWdmTask): Memory Corruption by task id - d3d28f8 and reset [[LVL700163706](#)]
14. failed to load factory defaults seen after firmware upgrade [[LVL700167818](#)]
15. [QoS ACL+IPv6] Please remove protocol type: IP and ICMP when IPv6 is selected. [[LVL700168204](#)]
16. [AP][Client Qos ACL+IPv6+IGMP] Only permit IPv6:IGMP, but fail. [[LVL700168209](#)]
17. [AP][Client QoS ACL+IPv6] Input ipv6 address ::33, WEB UI will appear debug message. [[LVL700168211](#)]
18. Cluster controller pushes power change to RADIUS-power-set AP [[LVL700169684](#)]
19. not seeing the managed peers on the dlink gui [[LVL700170818](#)]
20. Client database not purged when new cluster controller is elected [[LVL700170909](#)]
21. WLAN utilization doesn't change with change in traffic through AP. [[LVL700170915](#)]
22. Scheduler page missing some information. [[LVL700171193](#)]
23. Not able to set the static channel on the ap from the wireless cluster

- controller [[LVL700171319](#)]
24. Traps being sent to the syslog server do not have the time that was gotten from SNTP. [[LVL700171881](#)]
  25. Locking one radio channel in clustering channel management page causes both radios to be locked. [[LVL700172121](#)]
  26. Clustered 3600s do not share configs. [[LVL700172122](#)]
  27. Mac Authentication black list/white list not operating properly. [[LVL700174532](#)]
  28. When AP's are assigned addresses with x.x.x.255 they won't communicate to other devices. [[LVL700174543](#)]
  29. 3600 AP crashed while running Automation suit. [[LVL700174681](#)]
  30. Wireless kept old IP address after changing switch static IP to a new address in same subnet. [[LVL700174733](#)]
  31. 6600AP DFS channels do not trigger on RADAR [[LVL700169740](#)]
  32. 6600AP crashes while sending BCast & MCast flood into managed switch [[LVL700171115](#)]
  33. 6600AP crashes while attempting tunneling [[LVL700174549](#)]
  34. Call recover for a 6600AP – power doesn't go back down after the one neighbor comes back. [[LVL700171104](#)]
  35. WDS webpage on 6600AP takes excessively long to load. [[LVL700171955](#)]

## **Related Documentation:**

---

- DWS-x600AP Series Manual
- DWS-x600AP Series CLI Manual