



Firmware Version: 1.01rc022

Published Date: 2015/July/03

Content:

Upgrading Instructions:..... 2
 Upgrading by using Web-UI..... 2
New Features:..... 2
Changes of MIB & D-View Module:..... 2
Problems Fixed: 2
Known Issues: 3
Related Documentation: 3

Revision History and System Requirement:

Firmware Version	Date	Model	Hardware Version
1.01rc022	2015/July/03	DAP-3662	A1


Upgrading Instructions:

D-Link AP supports firmware upgrading via Web-UI. You may download the firmware from D-Link web site <http://tsd.dlink.com.tw>.

Upgrading by using Web-UI

1. Connect a work station to the LAN port of Access Point.
2. Open the web browser of work station and entering the IP address of the AP. The system default IP address is 192.168.0.50.
3. Enter administrator's username and password, user name is "admin" and leave the password field blank by default.

To update the AP's firmware, click **Maintenance > Firmware and SSL Certification Upload**

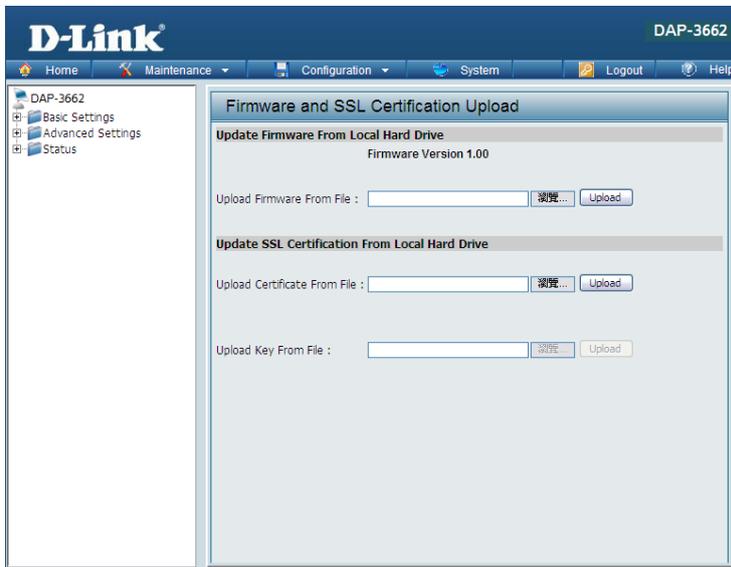

New Features:

- Support CWM v1.02
- Support SNMPv3
- Captive portal support in multiple SSID
- Support captive portal page customization
- Upload CWM configuration file from AP web UI.

Changes of MIB & D-View Module:

None

Problems Fixed:

Firmware Version	Problems Fixed
------------------	----------------

V1.01rc022	Fix high ping loss rate after bridging two DAP-3662 from LAN1 to LAN2.
------------	--

Known Issues:

Firmware Version	Known Issues
V1.01rc020	None

Related Documentation:

None